


SUBMITTAL INFORMATION

Repair Clamps - (FSP4-3600-Length style)

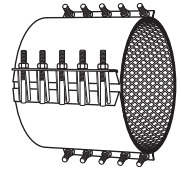

FOUR SECTION ALL STAINLESS STEEL REPAIR CLAMPS FOR HDPE PIPE

Lifter Bar
Type 304 heavy gauge stainless steel

Gasket
Gridded virgin SBR compounded for water service, per ASTM D2000. NBR (Buna-N) is optional.

Band
Type 304 stainless steel



Sidebar
Type 304 heavy gauge stainless steel

Lug
Type 304 heavy gauge stainless steel

Armor
Type 304 heavy gauge stainless steel, mold bonded into the gasket to ensure uniform compression against the pipe

Washers:
Belleville Spring Washer 17-7 PH stainless steel.
Note: Quantity may vary.

Bolts & Nuts
Type 304 stainless steel nuts and bolts per ASTM A193 and A194. Nuts are coated to prevent galling.

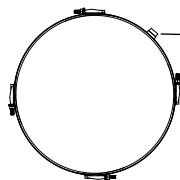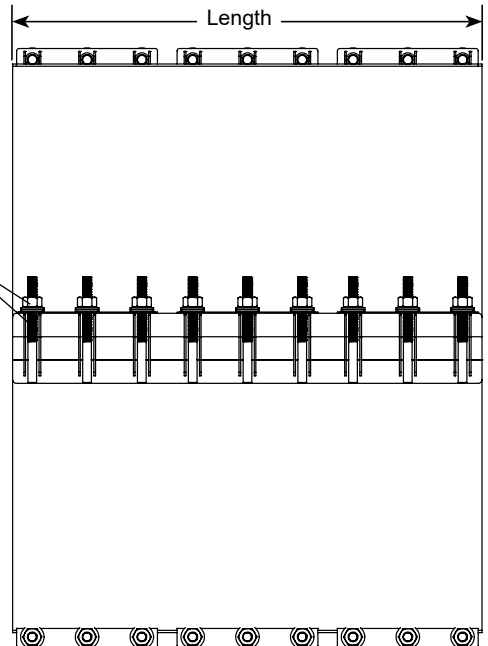

Optional Stainless Taps
Type 304 stainless steel TIG welded to band. Available with AWWA or I.P. threads.

OUTLET THREAD TAP CODE

CC (AWWA) Thread		IP Thread	
Thread	Code No.	Thread	Code No.
3/4" CC	-CC3	3/4" IP	-IP3
1" CC	-CC4	1" IP	-IP4
1-1/4" CC	-CC5	1-1/4" IP	-IP5
1-1/2" CC	-CC6	1-1/2" IP	-IP6
2" CC	-CC7	2" IP	-IP7

NOM. PIPE SIZE	PIPE O.D. RANGE (IN.)	LENGTH AND APPROX. WEIGHT (LBS.)		BOLT SIZE	BAND THICKNESS	CATALOG NUMBER	✓ SUBMITTED ITEM
		30"	36"				
36"	36.00	140	153	5/8" 11 UNC	20 GA.	FSP4-3600-Length	
Number of studs		36	40				

FEATURES

- NBR (Buna-N) gasket and conductivity strips are available
- Optional outlet taps are available for repair of service line pull-outs. Add tapping code to catalog number
- All welds are fully passivated to restore corrosion resistant characteristics of stainless steel

The Ford Meter Box Company considers the information in this submittal form to be correct at the time of publication. Item and option availability, including specifications, are subject to change without notice. Please verify that your product information is current. Our standard warranty applies.



The Ford Meter Box Company, Inc.
P.O. Box 443, Wabash, Indiana U.S.A. 46992-0443
Phone: 260-563-3171 / Fax: 800-826-3487
Overseas Fax: 260-563-0167
www.fordmeterbox.com

04/12/21

Submitted By: